



Per the Illinois Compiled Statutes, 625 ILCS 5/11-208.6 Automated Traffic Law Enforcement System:


*(k-7) A municipality or county operating an automated traffic law enforcement system shall conduct a statistical analysis to assess the safety impact of each automated traffic law enforcement system at an intersection following installation of the system. The statistical analysis shall be based upon the best available crash traffic and other data, and shall cover a period of time before and after installation of the system sufficient to provide a statistically valid comparison of safety impact. The statistical analysis shall be consistent with professional judgment and acceptable industry practice. The statistical analysis also shall be consistent with the data required for valid comparisons of before and after conditions and shall be conducted within a reasonable period following the installation of the automated traffic law enforcement system. The statistical analysis required by this subsection (k-7) shall be made available to the public and shall be published on the website of the municipality or county. If the statistical analysis for the 36-month period following installation of the system indicates that there has been an increase in the rate of accidents at the approach to the intersection monitored by the system, the municipality or county shall undertake additional studies to determine the cause and severity of the accidents, and may take any action that it determines is necessary or appropriate to reduce the number or severity of the accidents at that intersection.*

A Red Light Running (RLR) Photo Enforcement System was installed at the intersection of US Rte. 12/45 (Mannheim) at IL Rte. 19 (Irving Park) on May 11, 2009, after finding limited success with other attempted measures to promote safer driving and improve compliance with traffic laws. The following statistical analysis was performed through 2015. Calendar year 2016 was not included as the Illinois Department of Transportation (IDOT) has not yet completed collecting all data. The statistical analysis will be updated annually, as collected data becomes available from IDOT.



**US Rte. 12/45 (Mannheim) at IL Rte. 9 (Irving Park)**  
**Schiller Park, IL**

- RLR Photo Enforcement System monitors violations occurring on the northbound approach of the intersection
- RLR Photo Enforcement System installed: May 11, 2009
- RLR Photo Enforcement System temporarily suspended: August 12, 2012
- RLR Photo Enforcement System re-activated: April 7, 2017

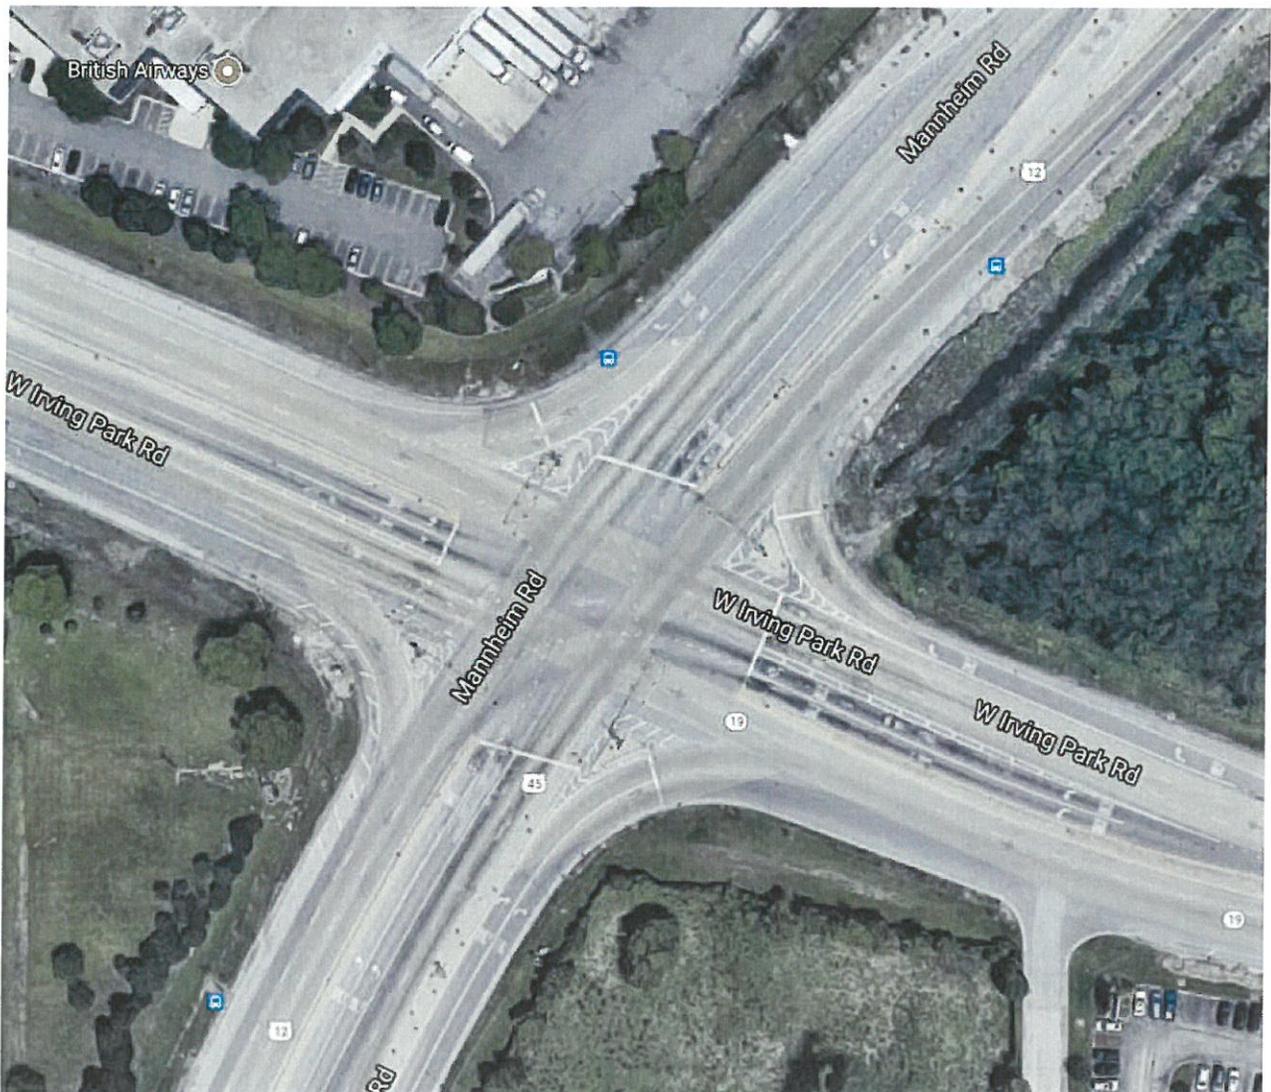



**US Rte. 12/45 (Mannheim) at IL Rte. 19 (Irving Park), Northbound Approach**



**US Rte. 12/45 (Mannheim) at IL Rte. 19 (Irving Park), Southbound Approach**





**US Rte. 12/45 (Mannheim) at IL Rte. 19 (Irving Park), Eastbound Approach**



**US Rte. 12/45 (Mannheim) at IL Rte. 19 (Irving Park), Westbound Approach**






## Average Daily Traffic

Data was obtained from the Illinois Department of Transportation's website  
[www.gettingaroundillinois.com](http://www.gettingaroundillinois.com).

US Rte. 12/45 (Mannheim) at IL Rte. 19 (Irving Park) (Northbound)

- 64,000 (2004)
- 50,000 (2006)
- 46,200 (2007)
- 37,500 (2009)
- 39,000 (2011)
- 46,400 (2013)

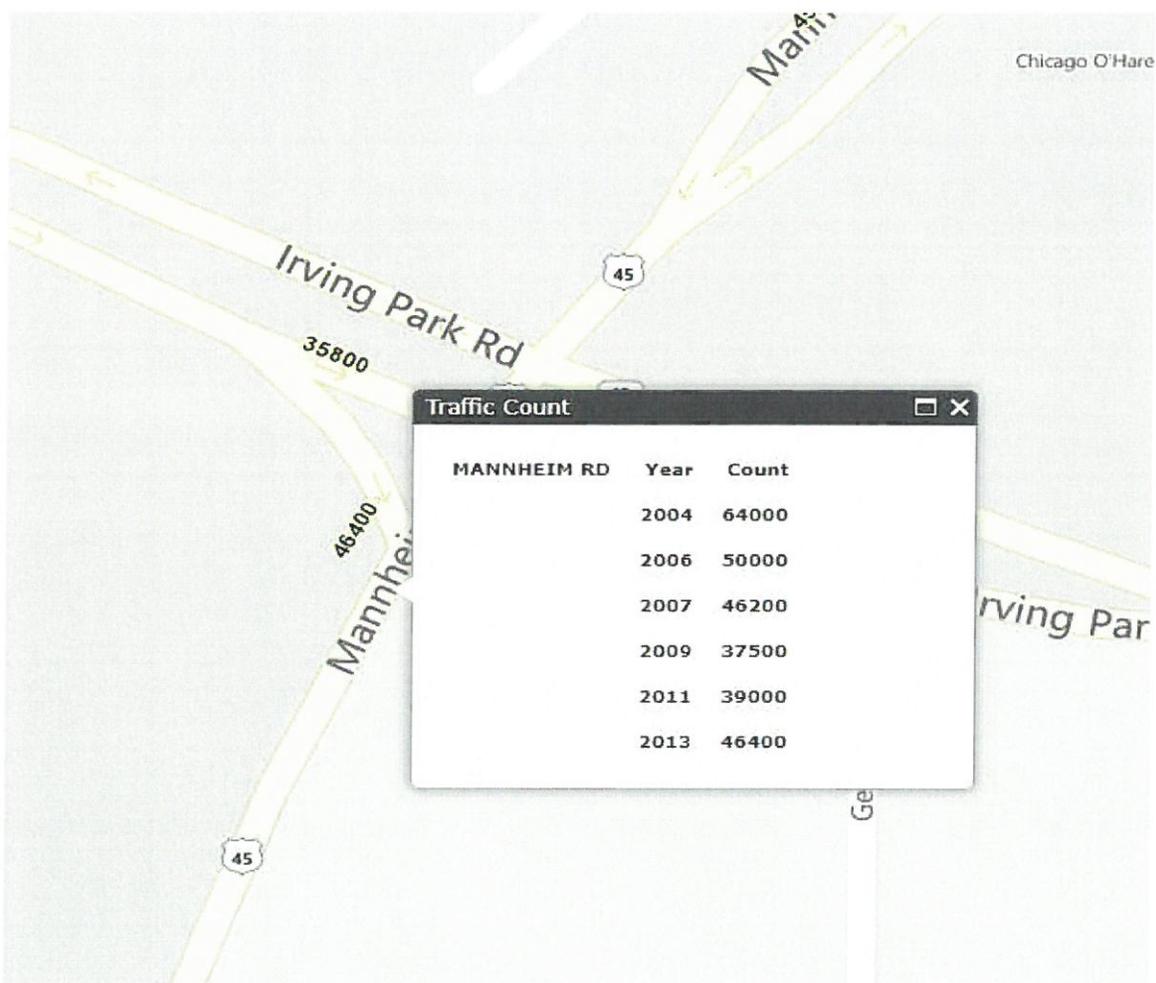




### Average Daily Traffic (continued)

Data was obtained from the Illinois Department of Transportation's website  
[www.gettingaroundillinois.com](http://www.gettingaroundillinois.com).

US Rte. 12/45 (Mannheim) at IL Rte. 19 (Irving Park) (Southbound)

- 58,700 (2004)
- 45,700 (2006)
- 47,100 (2007)
- 41,000 (2009)
- 43,900 (2011)
- 49,900 (2013)

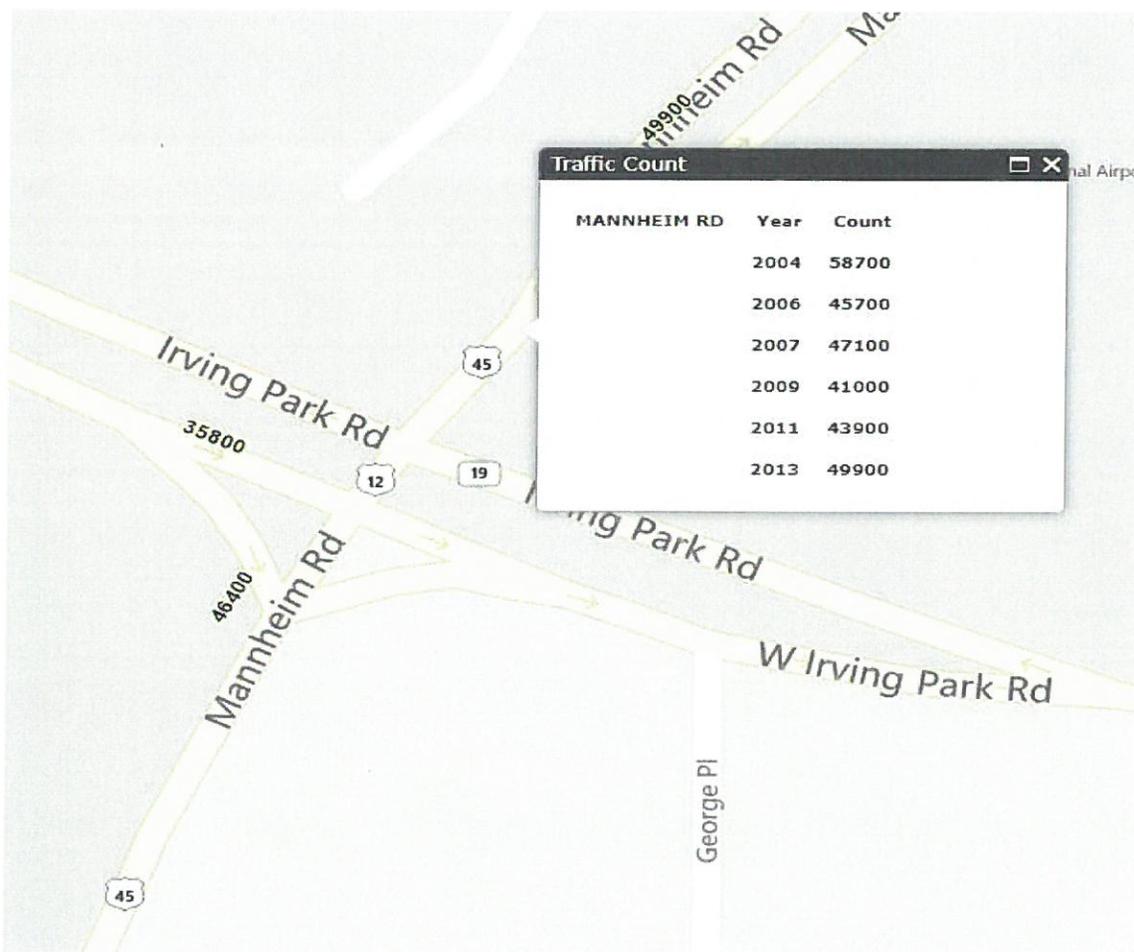




### Average Daily Traffic (continued)

Data was obtained from the Illinois Department of Transportation's website  
[www.gettingaroundillinois.com](http://www.gettingaroundillinois.com).

US Rte. 12/45 (Mannheim) at IL Rte. 19 (Irving Park) (Eastbound)

- 33,500 (2007)
- 35,100 (2009)
- 35,800 (2013)

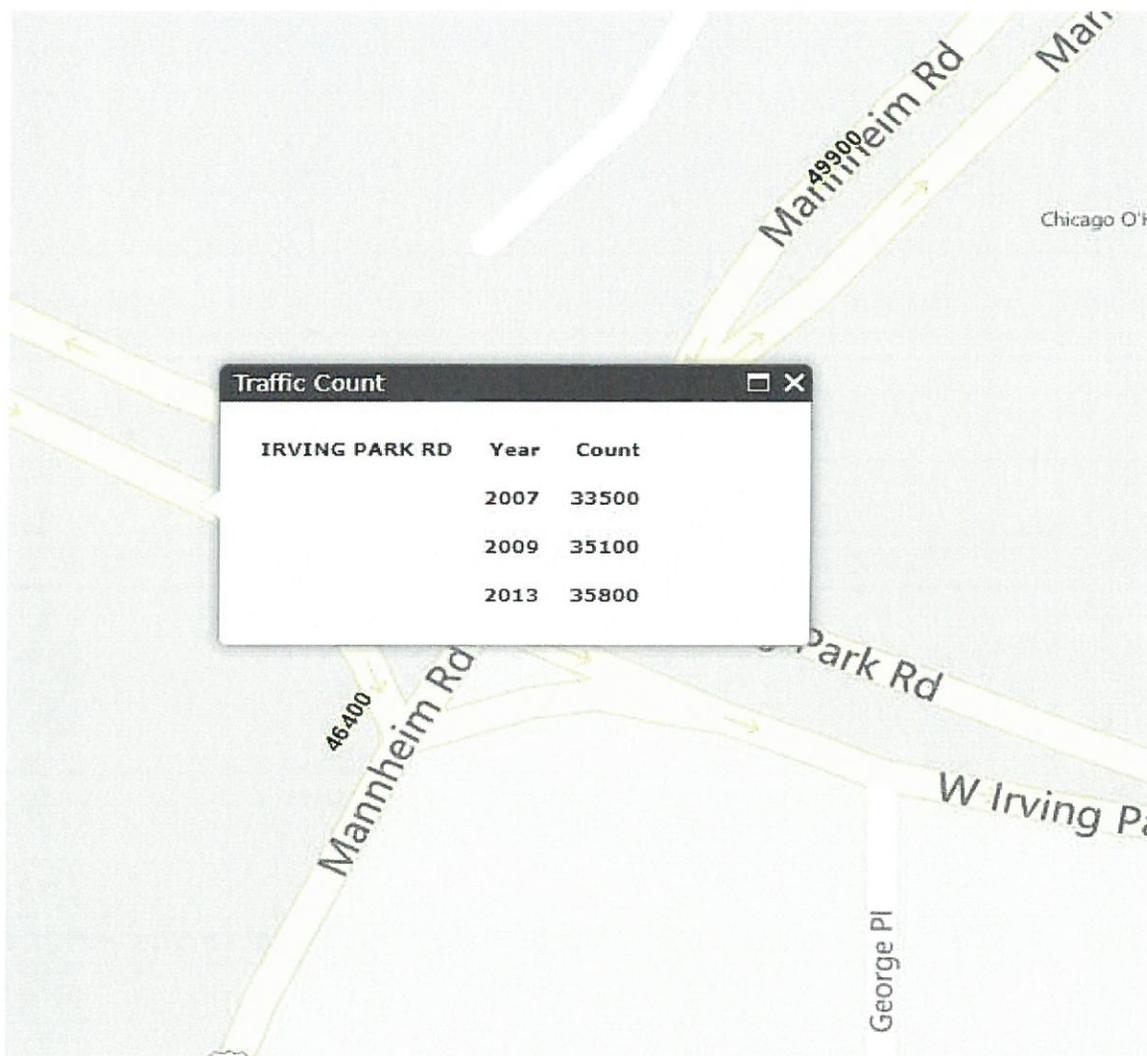




### Average Daily Traffic (continued)

Data was obtained from the Illinois Department of Transportation's website [www.gettingaroundillinois.com](http://www.gettingaroundillinois.com).

US Rte. 12/45 (Mannheim) at IL Rte. 19 (Irving Park)\_(Westbound)

- 37,900 (2005)

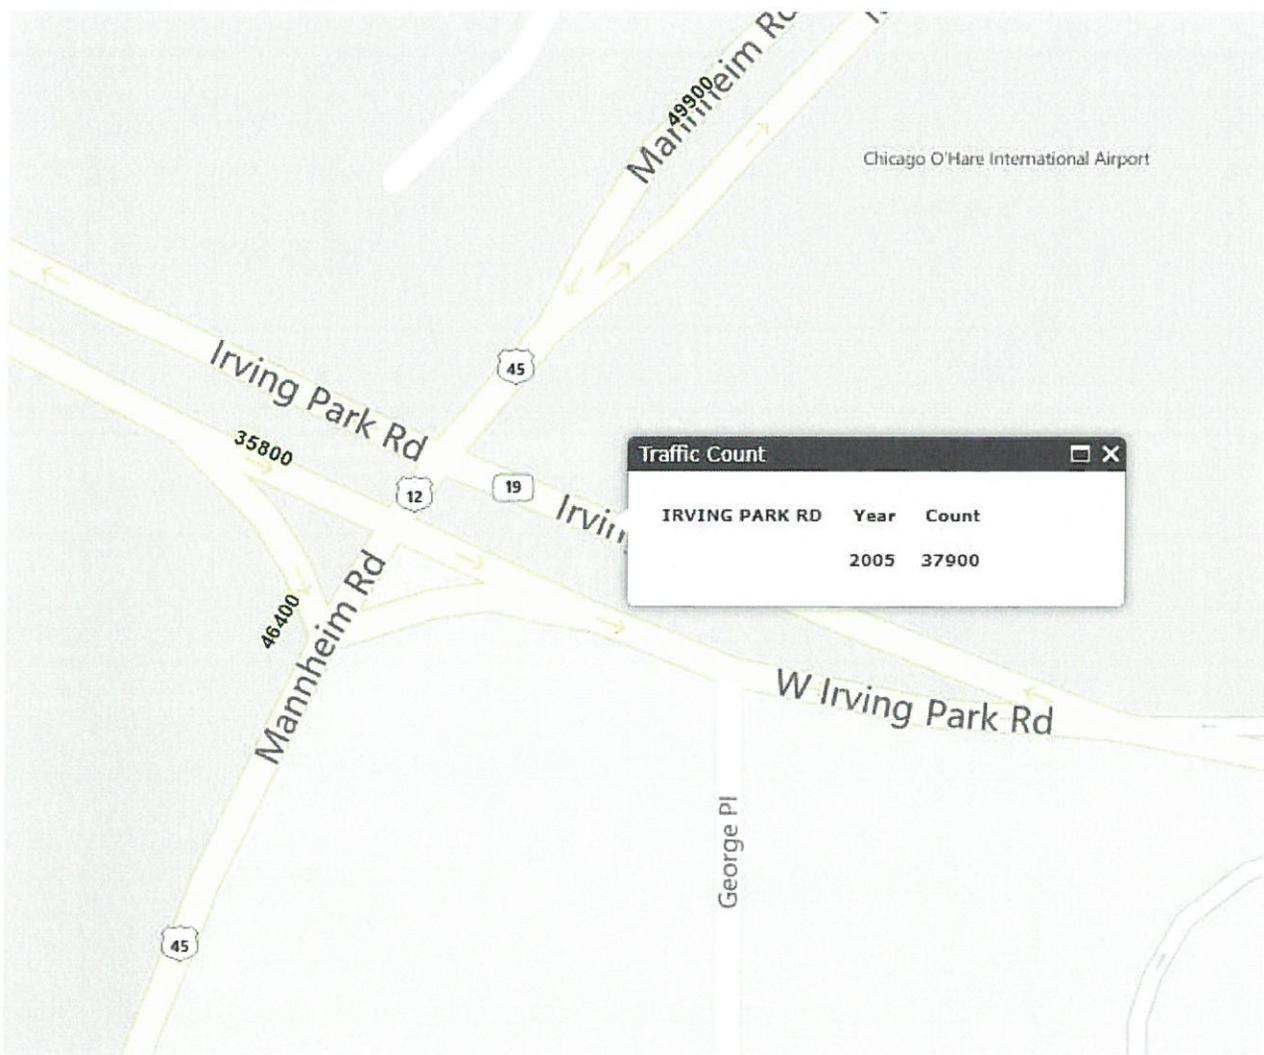



## Crash History and Analysis

- Table 1 includes crash data obtained from the Illinois Department of Transportation, detailing angle, turning, rear-end, and other type crashes occurring at the intersection pre/post RLR Photo Enforcement System installation.

### ALL INTERSECTION APPROACHES

	Crashes								
	Rear-End (% of Total)		Angle (% of Total)		Turning (% of Total)		Other (% of Total)		Total
2006	15	50.0%	2	6.7%	11	36.7%	2	6.7%	30
2007	26	45.6%	5	8.8%	16	28.1%	10	17.5%	57
2008	32	57.1%	4	7.1%	13	23.2%	7	12.5%	56
Total	73	51.0%	11	7.7%	40	28.0%	19	13.3%	143
2006-2008 Average	24.3		3.7		13.3		6.3		47.7

RLR Camera Installation: May 11, 2009									
2009	17	73.9%	1	4.3%	4	17.4%	1	4.3%	23
2010	10	66.7%	0	0.0%	5	33.3%	0	0.0%	15
2011	14	77.8%	1	5.5%	2	11.1%	1	5.5%	18

RLR Camera Suspension: August 12, 2012									
2012	14	66.7%	1	4.8%	4	19.0%	2	9.5%	21

RLR Camera Inactive: 2013-2016									
2013	14	58.3%	0	0.0%	6	25.0%	4	16.7%	24
2014	18	62.1%	1	3.4%	9	31.0%	1	3.4%	29
2015	11	55.0%	1	5.0%	6	30.0%	2	10.0%	20
Total	43	58.9%	2	2.7%	21	28.8%	7	9.6%	73
2013-2015 Average	14.3		0.7		7.0		2.3		24.3

- Other indicates the following: Pedestrian, Pedal Cyclist, Fixed Object, Sideswipe, Head-On and Unknown

Table 1

**DISCLAIMER:** The motor vehicle crash data referenced herein was provided by the Illinois Department of Transportation, based upon information derived from multiple sources. Any conclusions drawn from analysis of the aforementioned data are the sole responsibility of the data recipient(s). Additionally, for coding years 2015 to present, the Bureau of Data Collection uses the exact latitude/longitude supplied by the investigating law enforcement agency to locate crashes. Therefore, location data may vary in prior years, since the data prior to 2015 was physically located by bureau personnel. Given the subjective nature of the reporting process, the modifications in the incident locating protocols and the changes to the crash reporting thresholds effective 2009, the Village of Schiller Park acknowledges the potential for discrepancies in the final conclusions drawn.



**Crash History and Analysis (continued)**

- Table 2 includes crash data obtained from the Illinois Department of Transportation, detailing angle, turning, rear-end, and other-type crashes occurring at the intersection on the northbound approach only, pre/post RLR Photo Enforcement System installation.

**NORTHBOUND APPROACH ONLY  
 (PHOTO ENFORCED APPROACH)**

	Crashes								
	Rear-End (% of Total)		Angle (% of Total)		Turning (% of Total)		Other (% of Total)		Total
2006	4	44.4%	1	11.1%	4	44.4%	0	0.0%	9
2007	11	44.0%	3	12.0%	6	24.0%	5	20.0%	25
2008	9	45.0%	3	15.0%	7	35.0%	1	5.0%	20
Total	24	44.4%	7	13.0%	17	31.5%	6	11.1%	54
2006-2008 Average	8.0		2.3		5.7		2.0		18.0

RLR Camera Installation: May 11, 2009									
2009	8	88.9%	0	0.0%	1	11.1%	0	0.0%	9
2010	5	71.4%	0	0.0%	2	28.6%	0	0.0%	7
2011	0	0.0%	0	0.0%	0	0.0%	0	0.0%	0

RLR Camera Suspension: August 12, 2012									
2012	4	50.0%	1	12.5%	1	12.5%	2	25.0%	8

RLR Camera Inactive: 2013-2016									
2013	2	33.3%	0	0.0%	3	50.0%	1	16.7%	6
2014	9	64.3%	1	7.1%	4	28.6%	0	0.0%	14
2015	4	80.0%	0	0.0%	1	20.0%	0	0.0%	5
Total	15	60.0%	1	4.0%	8	32.0%	1	4.0%	25
2010-2015 Average	5.0		0.3		2.7		0.3		8.3

- Other indicates the following: Pedestrian, Pedal Cyclist, Fixed Object, Sideswipe, Head-On and Unknown

Table 2

**DISCLAIMER:** The motor vehicle crash data referenced herein was provided by the Illinois Department of Transportation, based upon information derived from multiple sources. Any conclusions drawn from analysis of the aforementioned data are the sole responsibility of the data recipient(s). Additionally, for coding years 2015 to present, the Bureau of Data Collection uses the exact latitude/longitude supplied by the investigating law enforcement agency to locate crashes. Therefore, location data may vary in prior years, since the data prior to 2015 was physically located by bureau personnel. Given the subjective nature of the reporting process, the modifications in the incident locating protocols and the changes to the crash reporting thresholds effective 2009, the Village of Schiller Park acknowledges the potential for discrepancies in the final conclusions drawn.



A comprehensive analysis cannot be completed, as the RLR camera equipment was not active for the entire year in 2009 or 2012. The Illinois Department of Transportation crash statistics have been released thru 2015 only. The RLR camera equipment was re-activated in April 2017. As more recent crash statistics are made available from IDOT, a comprehensive analysis will be provided.

The US Department of Transportation Project Development and Design Manual states that turning, angle or head-on crashes have a number of probable crash causes, to include:

- Large volumes of left /right turns
- Large total intersection volume
- Excessive speed on approaches
- Inadequate traffic control devices
- Poor visibility of signals

While red light cameras cannot truly decrease the volume of cars entering the intersection, speed and proximity of vehicles entering an intersection or the amount of turning traffic volume, red light cameras and red-light camera photo enforcement warning signs have the ability to reduce traffic crashes and improve compliance with traffic control devices.



### Adjudication Experience

RLR camera violations are contested and adjudicated through an administrative hearing conducted each month. Adjudication data for the Village’s Automated Enforcement Program is shown below in Table 3. Data compiled is not intersection specific, rather totals for the program as a whole.

<b>VILLAGE OF SCHILLER PARK ADJUDICATION FOR AUTOMATED PHOTO ENFORCEMENT PROGRAM</b>		
<b>YEAR /TOTALS</b>	<b>LIABLE</b>	<b>NOT LIABLE</b>
2008	111	17
2009	411	112
2010	329	124
2011	233	114
2012	116	67
2013	146	89
2014	181	44
2015	286	66
2016	332	78
2017	213	34
<b>YEAR TO DATE TOTAL:</b>	<b>2,358</b>	<b>745</b>

\*Adjudication data provided thru August 2017

Table 3

The high-quality video footage and photographic evidence produced by the enforcement system is a contributing factor in a majority of the contested RLR violations being upheld by the Hearing Officer. The police officers assigned to review and approve/reject potential violations are vigilant in applying the same officer discretion and criteria they would if issuing an in-person citation, resulting in only highly prosecutable violations being mailed out.